

Errata DA14531 Errata CE0001

Abstract

The document contains the known errata for the DA14531 along with recommended workarounds.

Product	DA14531	
Silicon Revision	0xAE / 0xAF (Register CHIP_REVISION_REG, CHIP_TEST1_REG and CHIP_TEST2_REG	
Datasheet Reference		
Package(s)	WLCSP 17 balls, 1.7x2.05, 0.5 mm pitch FCGQFN 24 pins, 2.2x3, 0.4 mm pitch	
Issue Date	sue Date 1-Nov-2019	

Errata



Contents

Ab	stract	•••••		1
Со	ntents	S		2
1	Terms and Definitions3			
2	Identifying the Silicon Revision			
3	3 Workarounds			
4	Errata Summary			3
5	Errat	a Details		4
	5.1	LO spur	s and TX harmonics at RFIO pin	4
		5.1.1	Effect	4
		5.1.2	Conditions	4
		5.1.3	Technical Description	4
		5.1.4	Workaround	4
5.2 System in boost is stuck at boot if Vbat_high load > 50 uA load			in boost is stuck at boot if Vbat_high load > 50 uA load	4
		5.2.1	Effect	4
		5.2.2	Conditions	4
		5.2.3	Technical Description	4
		5.2.4	Workaround	4
	5.3	Small in	put leakage current when xtal32k_m (P0_4 pin) is high	4
		5.3.1	Effect	4
		5.3.2	Conditions	5
		5.3.3	Technical Description	5
		5.3.4	Workaround	5
Re	vision	History		6

Errata



1 Terms and Definitions

GPADC	General Purpose Analog to Digital Converter
RFIO	Radio Frequency Input Output
LO	Local Oscillator
ТХ	Transmitter

2 Identifying the Silicon Revision

A readback of registers CHIP_REVISION_REG, CHIP_TEST1_REG and CHIP_TEST2_REG will give the device revision information.

3 Workarounds

For the cases where complex software workarounds are recommended in form of concept description, please refer to the special section of the SDK release notes that explains which items are addressed and how.

4 Errata Summary

Table 1: Errata Summary

	Bug/Enhancement
312	LO spurs and TX harmonics at RFIO pin
314	System in boost is stuck at boot if Vbat_high load > 50 uA load
306	Small input leakage current when xtal32k_m (P0_4) is high

Errata



5 Errata Details

5.1 LO spurs and TX harmonics at RFIO pin

5.1.1 Effect

RX spurs and TX harmonics at the RFIO pin. FCC/ETSI/Asian regulations are violated.

5.1.2 Conditions

Always.

5.1.3 Technical Description

- RX mode: LO spur (@ 4.8GHz)
- TX mode: harmonics might need filtering depending on application and antenna
- Root cause: Parasitic coupling path on the chip towards the output

5.1.4 Workaround

An external CLC (C=1.8pF, L=3.3nH) filter network to be used at RFIOp pin. For details please refer to the Application Note AN-B-073.

5.2 System in boost is stuck at boot if Vbat_high load > 50 uA load

5.2.1 Effect

DA14531 is not booting in the boost configuration when there is a load >50uA present on the V_{BAT_HIGH} rail. The system is then kept in the HW power up state machine.

5.2.2 Conditions

For a load >50uA present on the $V_{BAT_{HIGH}}$ rail during the initial booting.

5.2.3 Technical Description

In boost mode V_{BAT_HIGH} is charged from V_{BAT_LOW} via a resistive switch until a comparator triggers (V_{BAT_HIGH} > V_{BAT_LOW} - 50mV). Upon this threshold reached, the HW power up state machine will be allowed to continue. When there is a too large resistive load (>50uA DC) on V_{BAT_HIGH} this comparator will never trigger and the system remains stuck in the HW power up state machine.

5.2.4 Workaround

- Avoid a load more than 50uA during booting/powerup phase.
- If an external (SPI flash or I2C EEPROM) should be supplied by the boost DCDC then use a GPIO as a supply source to allow for zero lead at V_{BAT_HIGH} during boot.

5.3 Small input leakage current when xtal32k_m (P0_4 pin) is high

5.3.1 Effect

Pulling pin xtal32k_m high when the oscillator is disabled, results in a small leakage current into this pin (5 to 10nA at 25°C) affecting hibernation current of the application.

Errata

Revision 1.0

Errata



5.3.2 Conditions

When the pin is pulled up (high).

5.3.3 Technical Description

Pads can be pulled up during hibernation. This means that the inputs of the xtal32k oscillator will be high while the oscillator is disabled. Backdrive protection is implemented to avoid leakage, however the backdrive transistors are Native NMOS devices with higher channel leakage.

This means that channel leakage of the NMOST will flow into this bulk causing a slight input current on $P0_4$ (~5 to 10nA at 25C).

The other xtal32k pin (P0_3) does not suffer from this problem since the clamp has been implemented with long channel NMOSTs.

5.3.4 Workaround

None.



Errata

Revision History

Revision Date		Description		
1.0 1-Nov-2019		Code C version		
 Updated issues table with numbers Various corrections 				
0.1 11-Jul-2019		Clarifications, description improvements		
Errata in ES2 version				



Errata

Status Definitions

Status	Definition
DRAFT	The content of this document is under review and subject to formal approval, which may result in modifications or additions.
APPROVED or unmarked	The content of this document has been approved for publication.

Disclaimer

Information in this document is believed to be accurate and reliable. However, Dialog Semiconductor does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information. Dialog Semiconductor furthermore takes no responsibility whatsoever for the content in this document if provided by any information source outside of Dialog Semiconductor.

Dialog Semiconductor reserves the right to change without notice the information published in this document, including without limitation the specification and the design of the related semiconductor products, software and applications.

Applications, software, and semiconductor products described in this document are for illustrative purposes only. Dialog Semiconductor makes no representation or warranty that such applications, software and semiconductor products will be suitable for the specified use without further testing or modification. Unless otherwise agreed in writing, such testing or modification is the sole responsibility of the customer and Dialog Semiconductor excludes all liability in this respect.

Customer notes that nothing in this document may be construed as a license for customer to use the Dialog Semiconductor products, software and applications referred to in this document. Such license must be separately sought by customer with Dialog Semiconductor.

All use of Dialog Semiconductor products, software and applications referred to in this document are subject to Dialog Semiconductor's Standard Terms and Conditions of Sale, available on the company website (www.dialog-semiconductor.com) unless otherwise stated.

Dialog and the Dialog logo are trademarks of Dialog Semiconductor plc or its subsidiaries. All other product or service names are the property of their respective owners.

© 2019 Dialog Semiconductor. All rights reserved.

Contacting Dialog Semiconductor

United Kingdom (Headquarters)	North America	Hong Kong	China (Shenzhen)
Dialog Semiconductor (UK) LTD	Dialog Semiconductor Inc.	Dialog Semiconductor Hong Kong	Dialog Semiconductor China
Phone: +44 1793 757700	Phone: +1 408 845 8500	Phone: +852 2607 4271	Phone: +86 755 2981 3669
Germany	Japan	Korea	China (Shanghai)
Dialog Semiconductor GmbH	Dialog Semiconductor K. K.	Dialog Semiconductor Korea	Dialog Semiconductor China
Phone: +49 7021 805-0	Phone: +81 3 5769 5100	Phone: +82 2 3469 8200	Phone: +86 21 5424 9058
The Netherlands Dialog Semiconductor B.V. Phone: +31 73 640 8822	Taiwan Dialog Semiconductor Taiwan Phone: +886 281 786 222		
Email: enquiry@diasemi.com	Web site: www.dialog-semiconductor.com		

Errata

Revision 1.0

1-Nov-2019